

Elcometer 456³

Coating Thickness Gauge

Top Models

Operating Instructions



These instructions apply to the following Elcometer 456³ models:

Ferrous (F), Non-Ferrous (NF) and Dual Ferrous/Non-Ferrous (FNF)

Equipment described in these instructions is covered by the following Patents:

FNF UK Patent No: GB2306009B

FNF US Patent No: 5886522

F1 2 UK Patent No: 2367135B

F1 2 US Patent No. US 6,762,603

F1 2 German Patent Pending



This product meets the emc directive 89/336/EEC, amended 92/31/EEC and 93/68/EEC.

Bluetooth SIG QDID = B009627.

elcometer[®] and  are registered trademarks of Elcometer Ltd.

[®] and Bluetooth[®] are trademarks owned by Bluetooth SIG Inc and licensed to Elcometer Ltd.

All other trademarks acknowledged.

© Copyright Elcometer Ltd. 2004-2009.

All rights reserved. No part of this Document may be reproduced, transmitted, transcribed, stored (in a retrieval system or otherwise) or translated into any language, in any form or by any means (electronic, mechanical, magnetic, optical, manual or otherwise) without the prior written permission of Elcometer Ltd.

A copy of this Instruction Manual is available for download on our Website via www.elcometer.com/downloads.

*Doc.No. TMA-0424 Issue 06
Text with Cover No: 20243*

CONTENTS

Section	Page
1 About your gauge	4
1.1 Features	5
1.2 Standards	5
1.3 What this box contains	6
1.4 Conventions in these instructions	6
1.5 Quick-start	6
2 Getting started	7
2.1 Fitting the batteries	7
2.2 Battery condition.	7
2.3 Fitting probes	8
2.4 The controls	9
2.5 Switching the gauge on	9
2.6 Switching the gauge off	10
2.7 The screen	10
2.8 Selecting a language	11
2.9 Interfaces	12
3 Taking a reading	12
3.1 Before you start	12
3.2 Procedure	13

4 The reading screen and menus	13
4.1 Reading screen	13
4.2 Main MENU	14
4.3 Main MENU - Extended menu off	15
4.4 Main MENU - Extended menu on	18
5 Calibration adjustment	23
5.1 Calibration method	24
5.2 Preset calibration methods	25
5.3 Calibration foils and standards	25
5.4 Calibration adjustment procedure	26
6 Statistics	31
6.1 Enlarge stats	32
6.2 Stats on LCD	32
6.3 Clear stats	32
6.4 Select stats	32
6.5 Set NDFT	33
6.6 Display	35
7 Batching	35
7.1 Exit batching	36
7.2 Open new batch	36
7.3 Open existing batch	40
7.4 Review batches	41
7.5 Set limits	41

7.6 Free memory	42
8 Transferring readings to a computer	43
8.1 Transferring Using a Cable	43
8.2 Transferring Using a Bluetooth® connection	43
8.3 Transferring PSPC readings data to ElcoMaster	45
9 Probes	45
10 Personalised welcome screen	48
11 Storage and transit	48
12 Maintenance	48
13 Statistics terminology	50
14 Technical data	51
15 Accessories	52
16 Related equipment	55
17 Fitting the wrist harness	55
18 Probe measurement performance	56
19 Probe capabilities	57
20 Error messages	64
21 Index	66

Thank you for your purchase of this Elcometer 456³ Coating Thickness Gauge. Welcome to Elcometer. Elcometer are world leaders in the design, manufacture and supply of coatings inspection equipment. Our products cover all aspects of coating inspection, from development through application to post application inspection.

The Elcometer 456³ Coating Thickness Gauge is a world beating product. With the purchase of this gauge you now have access to the worldwide service and support network of Elcometer. For more information visit our website at www.elcometer.com.

1 ABOUT YOUR GAUGE

The Elcometer 456³ Coating Thickness Gauge is a handheld gauge for fast and accurate measurement of the thickness of coatings on metal substrates.

The gauge is available in three versions; Basic, Standard and Top. This manual describes the operation of the **Elcometer 456³ Top**.

All versions of the gauge feature an easy-to-use menu driven graphical interface which guides the user through tasks such as gauge configuration and calibration adjustment.

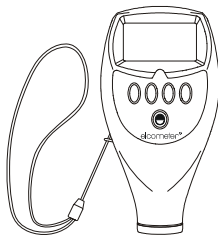


Figure 1.
Elcometer 456³
Coating Thickness
Gauge

The gauge is available either with a built-in integral probe or as a separate probe version. A wide range of probes is available to suit requirements - see page 45. Separate probes may be standard, miniature or Plug in Integral Probes (PINIP™), and must be ordered separately.

1.1 FEATURES

- A range of smooth and rough surface calibration adjustments.
- Menu driven backlit graphical user interface.
- Interchangeable probes (separate versions only).
- Statistics.
- Monitoring of readings to NDFT in accordance with 90/10 rule.
- Bluetooth® interface.
- RS232 interface.
- High/low limits.
- Memory of up to 50 000 readings in up to 999 batches.
- Clock/alarm.
- Date and time stamping.

1.2 STANDARDS

The Elcometer 456³ can be used in accordance with the following National and International Standards:

FERROUS (F)

ASTM B 499, ASTM D 1186-B, ASTM G 12, BS 3900(C5), BS 5411 (11), DIN 50981, IMO MSC.215 (82/84), ISO 1461, ISO 2063, ISO 2808-7C, ISO 2808-12, ISO 19840, NF T30-124, SSPC-PA2 (2004)

NON-FERROUS (NF)

ASTM D 1400, BS 3900 (C5), BS 5411 (3), BS 5599, DIN 50984, ISO 2360, ISO 2808-7D, ISO 2808-12

FERROUS AND NON-FERROUS (FNF)

AS 2331.1.4, AS 3894.3-B, AS/NZS 1580.108.1, ASTM D 7091, ASTM E 376, ECCA T1, EN 13523-1, ISO 2808-12, NSTM 631, SMS 6310-081-015, US NAVY NSI 009-32, US NAVY PPI 63101-000

1.3 WHAT THIS BOX CONTAINS

- Elcometer 456³ Gauge with integral probe, or Elcometer 456³ Gauge and separate probe (probe must be ordered separately)
- Calibration foils
- Gauge carrying pouch
- Wrist harness
- Batteries
- CD containing data collection software
- Operating instructions

1.4 CONVENTIONS IN THESE INSTRUCTIONS

The Elcometer 456³ is controlled using a simple menu structure which helps you get the most from your gauge - see page 18.

As an example, the LANGUAGES option which is in SETUP from the MAIN MENU would be shown in these instructions as **MENU/SETUP/LANGUAGES**.

These instructions include images of Elcometer 456³ screens with units set to microns (µm). Similar screens will be seen when the gauge is set to other units such as mils or inches.

1.5 QUICK-START

To quickly configure the gauge and start taking readings:

- | | |
|-----------------------------|-------------|
| 1. Fit batteries: | see page 7 |
| 2. Fit probe ^a : | see page 8 |
| 3. Switch on: | see page 9 |
| 4. Select language: | see page 11 |
| 5. Try taking a reading: | see page 12 |
| 6. Adjust calibration: | see page 23 |

The gauge is now configured and ready to use.

To maximise the benefits of your new Elcometer 456³, please take some time to read these Operating Instructions. Do not hesitate to contact Elcometer or your Elcometer supplier if you have any questions.

a. Gauges with separate probes only

2 GETTING STARTED

2.1 FITTING THE BATTERIES

1. Open battery compartment cover; press down in direction of arrow using thumb nail.
2. Insert 2 x LR03 (AAA), alkaline dry batteries taking care to ensure correct battery polarity (Figure 2).
3. Close battery compartment cover.

Rechargeable batteries can be used but they will only have 25% to 30% of the life of alkaline batteries.

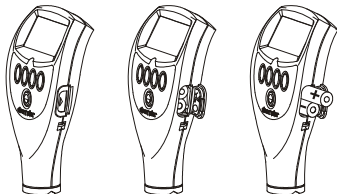


Figure 2. Fitting batteries - ensure correct battery polarity

2.2 BATTERY CONDITION.

Symbol	Battery condition/action required
	100%
	66% to 100%
	33% to 66%, replacement recommended.
	16% to 33%, replacement required.
	<16%, gauge beeps every 10 seconds and symbol flashes - immediate replacement required.
	5 loud beeps, gauge switches off automatically.

2.3 FITTING PROBES

(separate versions only)




To ensure correct transfer of data from the probe and detection of the new probe, the gauge **must be switched off** when separate probes are fitted.

A probe must be calibrated once it has been fitted - see "Calibration adjustment" on page 23.

To fit the probe


Align connector keyway and push in direction shown. The connector locks automatically.

Note: The design of the probe connector allows some movement between the probe and the gauge. This is intentional and does not affect measurement performance.

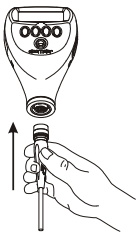


To release the probe

Grasp knurled section and pull gently away from the gauge. The connection will unlock and the probe will release.

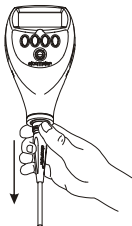


To fit the PINIP™

Twist the PINIP™ until the connector locates. Taking care not to cross the threads, lock the probe by turning the locking ring $1\frac{1}{2}$ times clockwise, or until tight.

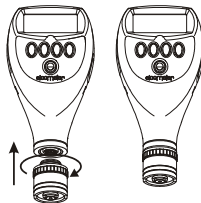

2.4 THE CONTROLS

The gauge is operated by 5 keys (Figure 3).

- On/Off key : Switches the gauge on or off.
- Softkeys: The function of these keys varies and is described by symbols and writing on the bottom line of the screen.
- LED: Red/green flashes when the gauge is switched on, green flashes when a reading is taken. Indicates when readings pass or fail the 90/10 rule (see page 33). Also indicates when a reading is inside or outside limits (see page 41).

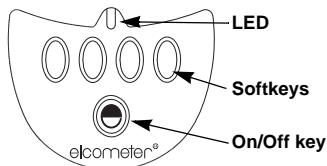


Figure 3. Elcometer 456³ control keys


2.5 SWITCHING THE GAUGE ON


Gauges with separate and PINIP™ probes:

Press  key to switch on gauge.



Gauges with integral probes:

Press  key to switch on gauge, or place the probe on a surface.

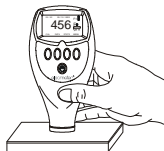


Note: Before switching the gauge on for the first time read “Selecting a language” on page 11.

2.6 SWITCHING THE GAUGE OFF

To switch off all gauge types, press and hold

⊖ key for 3 seconds.

The gauge will beep, two single tones followed by a double tone.

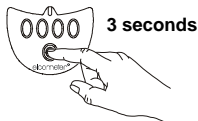

The Elcometer 456³ switches itself off 60 seconds after the last operation unless the Auto Switch Off time is changed (**MENU/SETUP/AUTO SWITCH OFF**). The Auto Switch Off feature can be set to a maximum of 10 minutes or can be deactivated - see "AUTO SWITCH OFF:" on page 22.

2.7 THE SCREEN

Familiarise yourself with the Elcometer 456³ screen. The screen displays:

- Welcome information
- Measurement information
- Menus to configure the gauge and control functions
- Help and miscellaneous information

When the gauge is switched on a welcome information screen may be displayed briefly (Figure 4).



Figure 4. Typical Elcometer 456³ welcome screen

The screen where measurement values and statistics are displayed is called the Reading Screen. The character size of the measurement value decreases as additional information is shown on the display (Figure 5). To maximise character size, switch off statistics (see Stats on LCD, page 32) and unlock the softkeys (see SOFTKEYS LOCKED:, page 23).




Figure 5. Typical Elcometer 456³ reading screens

2.8 SELECTING A LANGUAGE

The Elcometer 456³ has over 20 built-in languages. When the gauge is switched on for the first time after dispatch from the Elcometer factory the display will show the language selection screen (Figure 6).



Figure 6. Language selection screen

AT FIRST SWITCH ON

1. Press **Up/Down** softkeys to locate language required.
2. Press **SEL** softkey to activate the selected language.

The screen displays an Elcometer 456³ welcome screen (Figure 4) followed by the reading screen (Figure 5).

The gauge operates in the new language until changed.

AT ANY TIME

1. Switch gauge off.
2. Press and hold left hand softkey.
3. Press **⊙** key to switch on gauge.

The display will show language selection screen with current language highlighted by cursor.

4. Release left hand softkey.

Follow the instructions given above to select the language.

Alternatively, select **MENU/SETUP/LANGUAGES** - see “Main MENU - Extended menu on” on page 18.

2.9 INTERFACES

Your gauge is fitted with a Bluetooth® interface which makes the creation of personalised 'welcome' screens and transfer of information to and from a PC quick and easy - see "Transferring readings to a computer" on page 43.

If you do not have a Bluetooth® interface on your PC, you can still connect your gauge to your PC by using the optional PC connection cable (see 15.10, page 54) and the RS232 5-pin connector on the side of the gauge.

RS232 5-pin connector





Figure 7. RS232 interface

3 TAKING A READING

3.1 BEFORE YOU START

- *Are you using the correct type of probe?*
See "Probes" on page 45.
- *Is the probe calibrated?*
See "Calibration adjustment" on page 23.
- *Do you require statistics?*
See "Statistics" on page 31.
- *Do you want to save readings in memory?*
See "Batching" on page 35.
- *What units of measurement do you want to use?*
See "UNITS:" on page 21.

3.2 PROCEDURE

1. Press  key to switch on gauge.
2. Place probe on surface to be measured. **The reading may be inaccurate if the probe is not held as shown in Figure 8.**

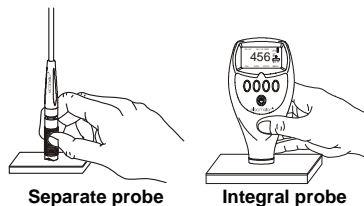


Figure 8. Taking a reading

3. Reading is displayed on screen (Figure 9).




Figure 9. Typical reading

4 THE READING SCREEN AND MENUS

4.1 READING SCREEN

The content of the reading screen (Figure 10, Figure 11) depends upon the type of measurement being made and how the gauge is set up.

Automatic-switching
probe symbol
(FNF probes only)

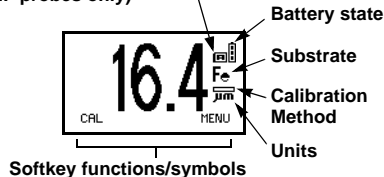


Figure 10. Example of reading screen with smooth surface calibration method selected

CAL: Operates selected calibration adjustment method.

MENU: This opens the main **MENU** of the gauge and provides access to user-selectable features - see page 18.

Note: If **CAL** softkey symbol is flashing the gauge should be recalibrated. This is due to the calibration adjustment method having been changed or a probe change - see “Calibration adjustment” on page 23. Batches cannot be created while the **CAL** softkey symbol is flashing.





Figure 11. Reading screen in extended mode and showing full set of statistical values.

If  is shown flashing in the top right corner of your display, it indicates that your gauge and your PC have established a Bluetooth® connection. When your gauge and PC are connected by Bluetooth®, you can transfer readings and batches using ElcoMaster software - see “Transferring readings to a computer” on page 43.

4.2 MAIN MENU

Gauge configuration and measurement functions are controlled using menus (Figure 12). The structure of the menus is shown on page 18.






Figure 12. Typical Elcometer 456³ menu

Some screens allow the status of a feature to be changed e.g. on to off or select or deselect, etc. A tick box ☐ indicates this type of feature. A tick against a menu item indicates the function is activated or selected.

SEL softkey selects the option displayed and in some cases toggles the status of a tick box off/on.

Up/Down softkeys   move the cursor to the menu item required. The menus scroll up/down and a line across the screen indicates the start and end of the menu.

BACK softkey returns the gauge to a previous screen. Holding this softkey down will rapidly exit from any menu and return to the reading screen.

SIMPLE AND EXTENDED MENUS

The Elcometer 456³ Top Gauge has two menu structures:

- Extended menu off (simple menu mode):**
 The gauge is shipped from the Elcometer factory with **EXTENDED MENU** turned off. In this simple menu mode the gauge can be calibrated and used to take measurements. This is the ideal setting for users who do not require access to advanced features of the gauge.
- Extended menu on (extended menu mode):**
 Additional items are automatically added to the **MENU** and the **STATS** softkey and **DATA** softkey are activated. These give access to more advanced functions such as statistics, batching, calibration method, print/output, setup, etc.

4.3 MAIN MENU - EXTENDED MENU OFF



Figure 13. Main menu - extended menu off

BACKLIGHT

Switches backlight on and off. Toggle tick box to activate/deactivate. With **BACKLIGHT** activated the display is illuminated for approximately 5 seconds when a reading is taken or a key pressed.

Note: The battery life is reduced by about one third when the backlight is activated.

CALIBRATION LOCKED

Protects against inadvertent calibration adjustment. Toggle tick box to activate/deactivate. If **CAL** softkey is pressed while **CALIBRATION LOCKED** is activated the gauge displays **CALIBRATION LOCKED USE MENU TO UNLOCK**. The message disappears after 3 seconds.

EXTENDED MENU

Provides access to additional features. Toggle tick box to activate/deactivate. See “Main MENU - Extended menu on” on page 18.

ABOUT

Provides information on Gauge, Probe, Contact information and Help (Figure 14):

GAUGE INFORMATION: Elcometer 456³ model, software versions, etc.

PROBE INFORMATION: Probe type, range, etc.

CONTACT: Details of Elcometer offices worldwide and, if programmed, the contact details for the Supplier or Local Distributor.

HELP: Explains symbols used on Elcometer 456³ display screens.

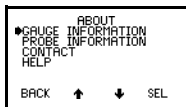


Figure 14. About menu

RESET

Selects Factory Calibration or Gauge resets. The **RESET** menu option (Figure 15) allows one of three gauge resets to be selected:

FACTORY CAL: Returns gauge to calibration settings created at time of manufacture of the probe.

Factory calibration will not necessarily restore precise calibration values. The calibration of the gauge should be adjusted before use, or at least checked to ensure that it has been previously adjusted correctly for the conditions of use.

INTL GAUGE^b: Resets gauge to International default settings e.g. DD/MM/YY date format and metric units.

-
- b. International settings can also be activated at switch on. Press and hold softkey 3 and switch on gauge.

USA GAUGE^c: Resets gauge to USA default settings e.g. MM/DD/YY date format and imperial units.





Figure 15. Reset menu

A confirmation screen will be displayed. Press **YES** to reset, **NO** to cancel.

-
- c. USA settings can also be activated at switch on. Press and hold softkey 4 and switch on gauge.

4.4 MAIN MENU - EXTENDED MENU ON

To toggle **EXTENDED MENU** on/off select **MENU/EXTENDED MENU/SEL**

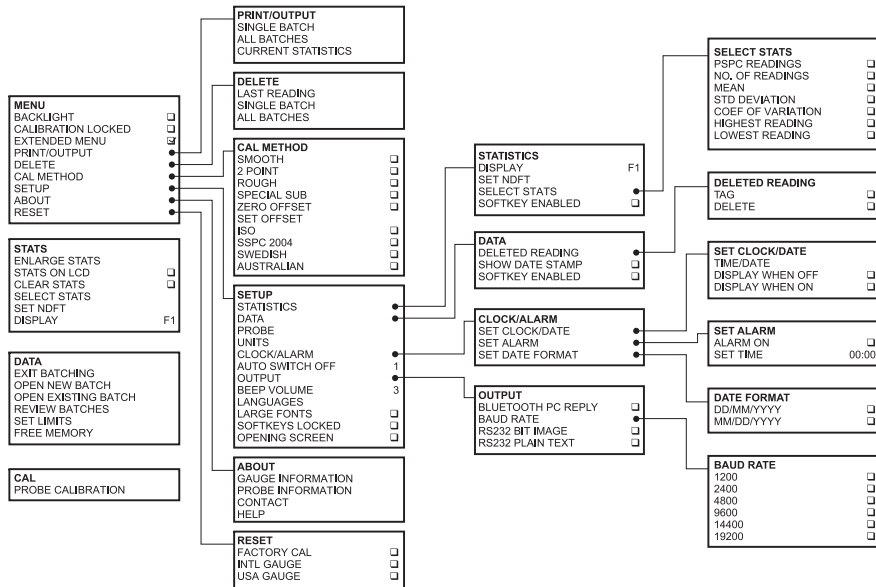

The following features are added to the **MENU** when **EXTENDED MENU** is active:

PRINT/OUTPUT

Outputs data to a printer or to a PC. A single batch of readings, all batches of readings, or the current statistical summary can be output via Bluetooth® or the RS232 interface.

To use this function, first setup using:

MENU/SETUP/OUTPUT - see "OUTPUT:" on page 22.

If no printers have been setup, **PRINT/OUTPUT** will display a **NOT AVAILABLE** message.

DELETE

Deletes last reading only, a single batch of readings or all batches of readings (Figure 16).



Figure 16. DELETE screen

LAST READING

Deletes last reading either in immediate mode or in batch mode.

Gauge displays **ARE YOU SURE?** (Figure 17).




Figure 17. Delete last reading confirmation screen

Press **NO** softkey to include reading in statistical summary or **YES** softkey to delete reading.

If there is no reading to delete gauge displays **LAST READING NOT AVAILABLE** (Figure 18).




Figure 18. Delete last reading not available screen

SINGLE BATCH

Deletes the batch data.

The gauge displays the current batch or the last batch used (Figure 19).




Figure 19. SINGLE BATCH screen

Use the **Right/Left** softkeys **← →** to locate the batch to be deleted. At either end of the list of batches the gauge beeps. Press **OK** when the batch to be deleted is displayed. Gauge displays **ARE YOU SURE?** Press **NO** softkey to leave data unchanged or **YES** softkey to delete the batch. If there is no data stored in the memory the gauge

displays **NOT AVAILABLE DATA MEMORY EMPTY** (Figure 20).



Figure 20. Memory empty screen

ALL BATCHES

Deletes all batches.

Gauge displays **ARE YOU SURE?** Press **NO** softkey to leave data unchanged or **YES** softkey to delete all of the batches.

CAL METHOD

Allows selection of calibration method from list of options - see "Calibration method" on page 24 for more details.

SETUP

Used to select, change or activate gauge features:

STATISTICS: Activates statistics feature.

Display - see "Display" on page 35.

Set NDFT - see "Set NDFT" on page 33

Select stats - see “Select stats” on page 32.

Softkey enabled - switches STATS softkey on/off.

DATA: Activates DATA softkey, SHOW DATE STAMP option and selects the DELETED READING menu (Figure 21).



Figure 21. DATA menu screen

SOFTKEY ENABLED allows DATA softkey to be turned off when **EXTENDED MENU** is active.

SHOW DATE STAMP - toggles date stamp on or off in Review Batches - see “Review batches” on page 41.

DELETED READING screen (Figure 22) allows readings to be tagged or deleted.





Figure 22. DELETED READING screen

TAG - readings still appear in the batch (with a tag-deleted symbol ) , but they are not included in statistical calculations.

DELETE - readings are permanently deleted.

PROBE: Only for dual function probes (FNF and F1 2). Changes probe mode.

FNF probes - select from Automatic, F or N.

F1 2 probes - select from F1 or F2.

UNITS: Units are automatically set by the probe type, however the user can manually override the automatic setting. Select from μm , mm, mil, thou or inch.

CLOCK/ALARM: Allows setting of time, date and alarm functions and setting of the date format DD/MM/YY or MM/DD/YY (Figure 23).




Figure 23. CLOCK/ALARM screen

Time and date can be set to be displayed on the top line of the reading screen when the gauge is on.

Time and date can be set to be displayed in large digits when the gauge is switched off.

AUTO SWITCH OFF: Changes delay before gauge switches off when displaying Reading Screen.

- Minimum = 1 minute
- Maximum = 10 minutes
- Default = 1 minute

Auto switch off may be disabled by selecting 'off' (In this case, switch off using On/Off key .

OUTPUT: Selects Bluetooth® PC Reply option, baud rate (Figure 24) and activates data output via the interfaces - see “Interfaces” on page 12.




Figure 24. OUTPUT screen

BLUETOOTH PC REPLY When the box is ticked, and a Bluetooth® connection is established between your gauge and a PC, the gauge will expect a reply from the PC after each reading is

taken. See “Transferring readings to a computer” on page 43 for further information.

BAUD RATE can be set at values from 1200 to 19200. The default value is 9600 baud.

RS232 BIT IMAGE Toggle tick box to activate/deactivate. When activated, readings are sent to the RS232 interface as they are taken. All images and characters are output as bit-maps. This allows printing on the Elcometer Miniprinter (see “Miniprinter” on page 54).

RS232 PLAIN TEXT Toggle tick box to activate/deactivate. When activated, readings are sent to the RS232 interface as they are taken. The gauge sends standard ASCII characters from the Courier New font set^d. This allows printing on devices other than the Elcometer Miniprinter, e.g. RS 232 printers or PC via Elcometer software (page 43) or via HyperTerminal.

-
- d. When RS232 Plain Text is selected the following languages will be output as English: Chinese, Greek, Hebrew, Japanese, Korean, Russian, Lithuanian, Farsi.

BEEP VOLUME: Changes volume.

- 0 = off
- 5 = loudest
- Default = 3

LANGUAGES: Allows selection of language.

LARGE FONTS: When ticked, displays all menus and screens using double height, single width fonts (for improved legibility, if needed).



Figure 25. Large fonts enabled

SOFTKEYS LOCKED: When ticked, the softkey functions will always be displayed.




Figure 26. Softkeys locked/unlocked

When un-ticked, the softkey functions disappear from the reading screen 5 seconds after the reading screen has been displayed, or 5 seconds after pressing any key. To view the functions again, press any one of the four softkeys.

Softkey functions are *always* visible in menus.

OPENING SCREEN: Disables the opening (welcome) screens so that the gauge switches on to display the reading screen.

If a personalised welcome screen has been downloaded into the gauge (see page 48), Opening Screen must be activated to display this screen.

5 CALIBRATION ADJUSTMENT

Calibration adjustment is the process of setting the gauge to known values of thickness to ensure accuracy on different substrate types, shapes and surface finishes.

Note: When using an FNF probe it must be calibrated in both the ferrous mode and in the non-ferrous mode to ensure accuracy of reading.

5.1 CALIBRATION METHOD

The calibration of the gauge can be adjusted (**MENU/CAL METHOD**) using several different methods described in National and International Standards.

The calibration adjustment method chosen is dependant on the condition of the substrate to be measured and is indicated on the screen by a symbol (Figure 27):




Figure 27. CAL METHOD screen

SMOOTH: Smooth surface calibration where the gauge is set to zero on the uncoated surface and a known thickness above the expected thickness of the coating.

2POINT: Calibration on a thin value and a thick value either side of the expected thickness. This enhances the accuracy of the gauge over the thickness range defined by the two values.

ROUGH: A calibration method similar to 2-Point. This enhances the accuracy of the gauge over the thickness range defined by the two values.

SPECIAL SUB: This method uses the 2-Point calibration for unusual substrate materials such as cast iron, certain types of stainless steel, high carbon steel, special aluminium alloys, etc.

ZERO OFFSET: This is the method described in ISO 19840 for coatings on steel surfaces roughened by blast cleaning. The calibration uses the smooth surface technique, and a correction value (zero offset) is applied to each reading to account for the effect of the roughened surface; the value depends on the surface profile - see Table 1.

SET OFFSET: This screen sets and changes the offset for different surface roughness. This value is used only with the Zero Offset calibration method.

Table 1: Correction values from ISO 19840

Profile according to ISO 8503-1	Correction Value (µm) (Zero Offset)
Fine	10
Medium	25
Coarse	40

5.2 PRESET CALIBRATION METHODS

The gauge also contains four preset calibration methods which follow relevant standards. These set the calibration method and the data collection method (data collection method is only set when in batching mode).

ISO: (ISO 19840) This uses the Zero Offset calibration method with counted average data collection set to 5 readings.

SSPC: (SSPC-PA2 2004) This uses the 2-Point calibration method with counted average set to 3 readings.

SWEDISH: (SS 18 41 60) This uses the 2-Point calibration method with counted average set to 5 readings.

AUSTRALIAN: (AS 3894) This uses the Zero Offset calibration method with a correction value of 1/3 the surface profile peak-to-valley height and a counted average data collection set to 5 readings.

Note: When the calibration method is changed, e.g. from Smooth to Rough, the gauge will display a message (Figure 28).




Figure 28. Recalibration required screen

If the **NO** softkey is pressed the **CAL** softkey symbol on the Readings Screen will flash to warn that calibration adjustment is still required. While the **CAL** softkey symbol is flashing new batches cannot be opened.

If the **YES** softkey is pressed the calibration adjustment procedure is activated - see "Calibration adjustment procedure" on page 26.

5.3 CALIBRATION FOILS AND STANDARDS

Calibration adjustment should be carried out with the appropriate probe on the same type of metal, the same curvature and similar finish to the item to be measured. It is best to use an uncoated sample of the items to be tested.

Calibration can be carried out using measured foils or coated standards.

FOILS (SHIMS): These are coating thickness standards which have been measured using techniques independent of the gauge. They are ideal for calibration because they provide a known value of thickness on the actual substrate to be measured. Calibration certificates for foils are available upon request.

When using foils care must be taken to keep the foils clean and free from dust and to avoid damage by creasing particularly the thinner foils. Always remove a foil from its storage wallet before use.

When calibrating a High Temperature PINIP™ Probe use the special thickness standards supplied with the probe - see “Calibrating High Temperature PINIP™ Probes” on page 31.

Note: To calibrate 5 mm (200 mils) and 13 mm (500 mils) range gauges it will be necessary to stack the foils (Figure 29). Care must be taken to

avoid errors due to placing the foil labels between the foils.

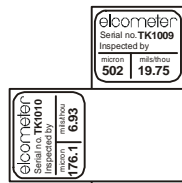


Figure 29. Stacking foils to increase thickness

COATED STANDARDS: Thickness standards using typical substrate materials coated with hardwearing materials and measured using techniques independent of the gauge.

Coated standards are most often used to confirm that the gauge meets its specifications if it is not possible to use foils (shims).

5.4 CALIBRATION ADJUSTMENT PROCEDURE

Calibration adjustment can be carried out at any time by pressing **CAL** softkey from the reading screen. To prevent inadvertent calibration

adjustment the **CAL** softkey can be locked (**MENU/CALIBRATION LOCKED**).

The user is guided through the operation of the chosen calibration procedure by means of instructions and illustrations on the graphics screen. Audible warnings are also provided when action is required, e.g. when the probe must be placed down to get a reading.

If the routine is interrupted in any way the previous settings will be restored until after the full calibration routine has been completed or the reset has been completed.

The screen detail depends on the calibration method chosen, but the calibration is in two steps.

The following example is for a Smooth Calibration adjustment.

Step 1

1. Hold probe in air and press **CAL** softkey (Figure 30).




Figure 30. Step 1 - on thickness standard

ESC softkey returns the gauge to the Reading Screen from the Calibration Procedure without making any changes.

TEST softkey allows the user to take readings to verify the accuracy of the current calibration. These readings do not affect statistical calculations and are not added to batch memory.

2. Place probe on calibration standard. The gauge will display a reading.
3. Lift probe and then replace on calibration standard. Gauge displays the average (\bar{x}) of

these readings and the last reading. Repeat this action until a stable reading is obtained.

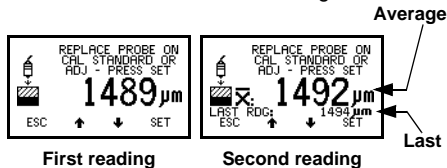


Figure 31. Step 1 - Calibration adjustment on thickness standard

To reject the displayed reading and start the calibration procedure again, press both the **Up** and **Down** softkeys at the same time.

To adjust the displayed reading until it is correct relative to the thickness standard use the **Up/Down** softkeys.

4. Press **SET** softkey to accept the value.

Note: - - - indicates over-range (Figure 32). Taking a reading within range clears this screen.




Figure 32. Over-range reading

Step 2

1. Place probe on uncoated standard or zero plate. The gauge will take and display a reading.
2. Lift probe and then replace on uncoated standard or zero plate. Gauge displays the average (x̄) of these readings and the last

reading. Repeat this action until a stable reading is obtained.



First reading

Second reading

Figure 33. Step 2 - Calibration adjustment on uncoated sample

To reject the displayed reading and start **Step 2** of the calibration procedure again, press the Reset softkey $\overline{X} \rightarrow [F1]$.

- Press **ZERO** softkey to zero the display (Figure 34).




Figure 34. Zero the display

- Press **SET** softkey to accept this value.

The gauge will display the option to test the calibration of the gauge.




Figure 35. TEST READINGS screen

- Either press **NO** softkey to complete the calibration adjustment procedure and return the gauge to the reading screen, or proceed to take test readings - see Taking test readings below.

Taking test readings

Press **YES** softkey (see previous section) to take test readings. This allows the calibration of the gauge to be tested without adding readings to data memory or contributing to the statistical calculations.




Figure 36. TEST READINGS screen

CAL softkey returns the gauge to **Step 1** of the calibration adjustment procedure.

OK softkey exits the calibration adjustment procedure and returns the gauge to the reading screen.

Other calibration methods

For the 2-POINT, ROUGH and SPECIAL SUBSTRATE calibration methods **Step 2** requires

readings to be taken on a thin standard value instead of on an uncoated base.





Figure 37. Step 2 - On thin standard

Repeating the reading will display the average. This is particularly useful for rough surfaces as it allows variations in the surface to be accounted for in the calibration adjustment, therefore improving the accuracy of the gauge.



First reading

Second reading

Figure 38. Step 2 - Calibration adjustment on thin standard

Calibrating High Temperature PINIP™ Probes

Special thickness standards are supplied with F1 2 High Temperature PINIP™ Probes - see page 47. These thickness standards should be used in place of the calibration standard in **Step 1** of "Calibration adjustment procedure" on page 26.

1. Place appropriate thickness standard over end of PINIP™ probe.
2. Press **CAL** softkey.
3. Place probe on hot^e surface and take a reading.
4. Lift probe and then replace on hot surface to take second reading.
5. Repeat as necessary until reading is stable.
6. Press **SET** to accept value.
7. Remove thickness standard from end of PINIP™ probe.
8. Proceed with **Step 2** - see page 28.

e. The temperature of the surface used for calibration should be equal to the temperature of the substrate being measured.

6 STATISTICS

The Elcometer 456³ Top has a Statistics feature (**STATS**) which calculates and displays a statistical analysis of readings as they are taken. The statistical calculations are also applied to the readings stored within a single batch in memory.

When **EXTENDED MENU** is active, press **STATS** softkey to access **STATS MENU** (Figure 39).



Figure 39. Stats menu

The statistics available are:

- Number of Readings **T**:
- Mean **\bar{x}** :
- Standard Deviation **σ** :
- Coefficient of Variation **$CV\%$** :
- Highest Reading **\gg** :
- Lowest Reading **\ll** :
- % greater to or equal to NDFT **$\gg N$** :

- % between 90% and 100% of NDFT $\frac{90}{100}$
- 90/10 pass or fail $\frac{90}{10}$

For more information see:

- “Select stats” on page 32.
- “Statistics terminology” on page 50.

6.1 ENLARGE STATS

Displays the chosen statistical values as double-height characters. The example screens (Figure 40) appear when all the statistical values are selected. The **Up/Down** softkeys can be used to move through the list. **OK** softkey returns to the Reading Screen.




Figure 40. Enlarged statistics

6.2 STATS ON LCD

Activates the presentation of the chosen statistical values on the reading screen. If STATS ON LCD is activated while CLOCK ON LCD is active, the

STATS are displayed and the CLOCK is not displayed.

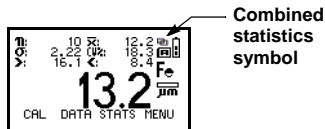


Figure 41. Reading screen with all statistics

6.3 CLEAR STATS

Resets to zero all statistical values selected in **STATS MENU/DISPLAY**.

6.4 SELECT STATS

Allows the user to choose which statistical values are displayed. The default condition is all values except PSPC readings (Figure 42).



Figure 42. Select stats menu

Use **Up/Down** softkeys to move cursor and **SEL** softkey to select or deselect the statistical values.

Note: When PSPC readings is selected, no other values can be selected and the SET NDFT screen will be displayed automatically.

See “Set NDFT” on page 33 for further information about PSPC and NDFT.

6.5 SET NDFT

The factory default value^f for NDFT^g is 320 µm (12.6 mils).

If you need to adjust this value, select ‘SET NDFT’, use the **Up/Down** softkeys **↑ ↓** to adjust the value and then press **OK**. If any readings have been taken in immediate mode, a screen will be displayed warning that the statistics will be cleared. Press **YES** to continue (to change the NDFT value) or **NO** to escape (and leave the value unchanged).

ABOUT PSPC^h READINGS

Your gauge is capable of displaying PSPC readings according to the 90/10 rule as defined in the IMOⁱ requirements.

To pass the 90/10 rule (Figure 43):

- At least 90% of all thickness measurements shall be greater than or equal to NDFT, and
- none of the remaining measurements shall be below 0.9 x NDFT.

f. Default value from PSPC for Ballast Water Tanks
g. Nominal Dry Film Thickness

h. Performance Standard for Protective Coatings
i. International Maritime Organisation

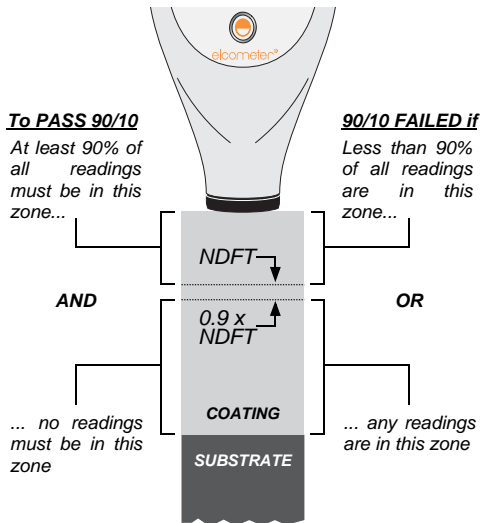


Figure 43. Pass/Fail criteria for 90/10 rule

When PSPC statistics are selected the standard statistics displayed on the screen are replaced by those for PSPC (Figure 44):




Figure 44. PSPC statistics - selected and displayed on reading screen

While you are taking readings with PSPC statistics selected, your gauge will beep and flash the LED:

Pass ✓: 1 beep Green flash

Fail (90%) ✗: 3 beeps Green flash

Fail (<0.9xNDFT) ✗: 3 beeps Red flash

Note: The 90/10 rule is not compatible with the counted average data collection method (see page 38) and cannot be used when saving readings using this method. If PSPC readings are selected while in counted average batch mode, or a counted average batch is opened while PSPC readings are being displayed a warning screen will be displayed.


Note: Refer to "Transferring PSPC readings data to ElcoMaster" on page 45 for additional information.

6.6 DISPLAY

Only applies when using dual function probes. Allows selection of the types of readings used in the statistical calculation when a dual function probe is connected.

Probe Options

FNF	F, N or F and N combined ^j
F1 2	F1, F2 or F1 and F2 combined ^j

j. When readings are combined a  symbol will be displayed on the Reading Screen (Figure 41).

7 BATCHING

The Elcometer 456³ operates in one of two modes; immediate or batch.

IMMEDIATE MODE: The gauge takes readings and calculates statistics but does not store any readings in memory (Figure 45).




Figure 45. Reading screen - Immediate mode

BATCH MODE: The gauge takes readings and calculates statistics and stores readings in memory (Figure 46). The gauge stores readings in one of up to 999 separate batches.

Batch mode (batching) allows reading data to be collected in groups to allow easier analysis of large structures or complex assemblies.



Figure 46. Reading screen - Batch mode

The Elcometer 456³ Top has memory capacity for up to 50 000 readings in up to 999 batches.

Batching is configured using the **DATA MENU**.

To access the **DATA MENU** (Figure 47) press the **DATA** softkey (this softkey is only displayed with **EXTENDED MENU** on).




Figure 47. DATA MENU screen

7.1 EXIT BATCHING

This option returns the gauge to immediate mode and no further readings are stored in memory. The gauge returns to the Reading Screen.

7.2 OPEN NEW BATCH

This option opens (creates) a new batch using the next available batch number.

- To create a batch with new calibration settings use **OPEN NEW BATCH** in immediate mode - see page 37.
- To create a batch with a copy of the calibration settings from another batch use **OPEN NEW BATCH** in batch mode - see page 39. This is known as '**cloning**' a batch.

Cloning is typically used when several products are being tested, each with different measurement and calibration settings. Cloning allows the settings for a product to be quickly and easily duplicated. To clone a batch, first open the batch to be cloned (see section 7.3 on page 40) and then **OPEN NEW BATCH**.

Note: While the **CAL** softkey symbol is flashing, new batches cannot be opened. Calibrate the gauge before opening a new batch. FNF probes should be calibrated in F mode and in N mode.

Opening new batch in immediate mode

When a new batch is opened the following settings are copied into the batch from **immediate mode**:

- Calibration method
- Offset (if applied)
- Calibration adjustment

Note: Calibration method and offset must be set before opening the new batch. Calibration adjustment can be changed after the batch has been created - see "Calibration adjustment procedure" on page 26.

The initial **OPEN NEW BATCH** screen (Figure 48) stays on while the gauge sets up the batch, as indicated by the progress bar.



Figure 48. Initial OPEN NEW BATCH screen - Immediate mode

ESC takes the gauge back to **DATA MENU**.

The second **OPEN NEW BATCH** screen (Figure 49) shows the current batch settings.

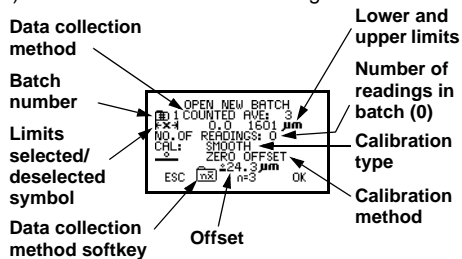



Figure 49. Second OPEN NEW BATCH screen - Immediate mode

Upper and lower **Limits** for the batch can be changed at any time once the batch has been created - see "Set limits" on page 41.

Data collection method must be set before **OK** softkey is pressed.

Data Collection Method


The Data Collection Method can be changed by pressing the **Data Collection Method** softkey  or

. The display toggles between two options, normal and counted average:

- **NORMAL** - Each reading is added to the number of readings and contributes to the statistical calculation.
- **COUNTED AVE: n** - Readings are taken in preset groups^k, the default being 5 readings, n=5 (Figure 50). At the end of each group the gauge beeps and calculates the average for the group and stores this average value, which is used for the statistical calculation. The individual readings in the group are not stored.

k. When using an FNF probe in AUTO mode the first reading in each group will 'lock' the probe to that substrate for the whole of the group.

The value for n can be changed^l by pressing the **n=5^m** softkey.



**Figure 50. Setting data collection method
Counted average n = 5**

Note: Counted average data collection mode is not compatible with the 90/10 rule and therefore cannot be used while PSPC readings are selected.

Opening new batch in batch mode

Opening a new batch in batch mode duplicates (clones) an existing batch.

Cloning copies the following settings to the new batch:

- Limits

- l. If a preset calibration method (see “Preset calibration methods” on page 25) is selected, the value for ‘n’ cannot be adjusted.
- m. The value for ‘n’ shown on the softkey can be any number between 2 and 255.

- Calibration method
- Data collection method
- Offset (if applied)
- Calibration adjustment

Note: Calibration method, data collection method and offset cannot be changed once the cloned batch has been created. Calibration adjustment and limits can be changed after the batch has been created - see “Calibration adjustment procedure” on page 26 and “Set limits” on page 41.

The initial **OPEN NEW BATCH** screen displays ‘**CURRENT BATCH**’.



**Figure 51. Initial OPEN NEW BATCH screen -
Batch mode**

The second **OPEN NEW BATCH** screen (Figure 52) shows the new batch settings.

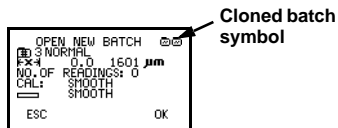


Figure 52. Second OPEN NEW BATCH screen - Batch mode

Press **OK** to create batch.

Batch numbering

The gauge automatically allocates the next batch number when a new batch is created. Up to 999 batches can be active at any time. Deleted batches are removed from the list so that batch numbers above 999 are valid. A deleted batch number cannot be reused until all the batches are deleted, when the batch number count starts again at 1.

7.3 OPEN EXISTING BATCH

This allows any batch to be opened to add readings. If the gauge is switched off with the batch open, the

current batch will re-open when the gauge is switched back on.

Note: If the probe is changed to another probe of the same type the gauge will display a warning (Figure 53).




Figure 53. Changed probe warning screen

If **NO** is selected, the serial number and calibration data of the new probe are saved into the current batch as a data entry.

If **YES** is selected, the batch calibration details are retained and the user can locate and fit the original probe, if they wish.

The gauge will display the current settings (Figure 56). Values shown are for illustration only.




Figure 56. Setting upper and lower limits

Adjust the values with **Up/Down** softkeys. When the correct value is displayed, press **OK** to enter.

With **LIMITS ON** activated the out-of-limits reading will be indicated by a triple beep and a red light on the keypad LED. A reading within limits is indicated by a single beep and a green light. Out-of-limits symbols \uparrow and \downarrow will be stored in the batch and can be seen when the batch is reviewed.

7.6 FREE MEMORY

This option displays the amount of free memory available for storage of readings (Figure 57).




Figure 57. FREE MEMORY screen

8 TRANSFERRING READINGS TO A COMPUTER

Your gauge comes complete with software which allows data to be transferred to a PC using Bluetooth® or the optional PC connection cable. The CD supplied with your gauge includes the following software:

- **Elcometer Data Transfer Software (EDTS+ Excel Link).** This software allows the user to transfer data from the memory of the gauge into Microsoft Excel using the PC connection cable. The data can then be processed in software such as Word or Excel.
- **ElcoMaster Software for Measurement Data.** This software allows the user to transfer data from the memory of the gauge to a PC for archiving, analysis and reporting. Data can be transferred using the PC connection cable or Bluetooth®. Data can also be transferred as the measurements are taken. ElcoMaster includes all the charts that you may need together with a report designer to let you design your reports the way you wish to see them. ElcoMaster can

also be used to create personalised welcome screens and upload them to your gauge.

- **ElcoMaster Data Conversion Software.** This software converts existing measurement data to ElcoMaster format. The following types of measurement data can be converted; Elcometer EDCS Win, EDCS Plus and EDCS.

All this software can also be downloaded from the Elcometer website www.elcometer.com/downloads


8.1 TRANSFERRING USING A CABLE

1. Connect your gauge to your PC using the optional cable.
2. Switch on your gauge and ensure the Reading Screen is displayed.
3. Start the software and follow the instructions included with the software.

8.2 TRANSFERRING USING A BLUETOOTH® CONNECTION

Full instructions on how to interface your gauge with ElcoMaster and download data are included with the ElcoMaster help file supplied with the software.

VERIFYING A BLUETOOTH® CONNECTION

When a Bluetooth® connection is established between your gauge and a PC, the gauge produces two high pitch beeps and shows a flashing Bluetooth® icon  in the top right corner of the display. When the connection is closed or lost, the gauge produces two lower pitch beeps and the icon is removed.

BLUETOOTH® PIN

If at any time ElcoMaster requests a PIN number for your gauge, switch on your Elcometer 456³ and select MENU>ABOUT>GAUGE INFORMATION. The display will show the Bluetooth® PIN (in the example shown in Figure 58, '19400'):




Figure 58. PIN code

Each gauge has a different PIN - use the PIN shown on your Gauge Information screen.

TRANSFERRING MEASUREMENTS AS THEY ARE TAKEN

Measurement data can be transferred from your gauge to a PC via a Bluetooth® connection as the readings are taken.

Your gauge includes a feature which checks that a reading taken by the gauge has arrived successfully at your PC. If the reading does not arrive at your PC, an error message is displayed on your gauge and further readings cannot be taken until it is cleared.

To use this feature, tick the Bluetooth® PC Reply box under MENU>SETUP>OUTPUT - see "OUTPUT:" on page 22.

When the box is ticked, and a Bluetooth® connection is established between your gauge and a PC, the gauge will expect a reply from the PC after each reading is taken.

If this reply is not received within half a second of sending the reading, an error message will be displayed (Figure 59).




Figure 59. Bluetooth PC Reply error message

If the Bluetooth® connection is still established and the reply is received after half a second then the message will clear automatically, (this indicates that the Bluetooth® connection is operating at the limit of its range). If the Bluetooth® connection has been lost, then the error message will remain on the screen until a key is pressed.

8.3 TRANSFERRING PSPC READINGS DATA TO ELCOMASTER

When transferring PSPC readings to ElcoMaster, run ElcoMaster and then tick the 'Use 456 Gauge NDFT' box in File>Preferences>Batch Info>NDFT Settings.

This will ensure that the NDFT value is transferred from your gauge in addition to the readings data.

9 PROBES

An extensive range of probes is available for the Elcometer 456³ Coating Thickness Gauge. Probes for ferrous (F), non-ferrous (N) and dual ferrous/non-ferrous (FNF) operation are available as either integral (built-in) or separate options.

Separate probes are fully interchangeable and are available in standard, PINIP™ and miniature formats.

PINIP™ format (Plug-In Integral Probe) is an integral style probe which plugs in to a separate gauge. This provides all the benefits of an integral gauge and the flexibility of a separate gauge in a single unit.

Miniature separate probes permit measurements where space is restricted.

9.1 FERROUS (F) PROBES

F probes measure the thickness of non-magnetic coatings on magnetic substrates. They can be used

on paint, plastic, galvanising, enamel, powder paint, hard chrome and other coatings such as electroless nickel applied to steel or iron.

9.2 NON-FERROUS (N) PROBES^N

N probes measure the thickness of non-metallic coatings on non-magnetic metals. They can be used on anodising, paint, plastic coatings, powder paint, etc. applied to aluminium, brass, non-magnetic stainless steel, etc.

9.3 DUAL FERROUS/NON-FERROUS (FNF) PROBES

FNF probes are dual function, F and N in one probe. FNF gauges will automatically detect the type of substrate and set the mode accordingly. Alternatively the mode can be set manually - see "PROBE:" on page 21 and "Coatings on galvanised or metallised steel" on page 47.

-
- n. Using an N probe (or an FNF probe manually set to N1) on a ferrous substrate will give a reading, but the reading will be incorrect.

9.4 PROBE INTERCHANGEABILITY

The following table shows which probes can be used in the three types of Elcometer 456³ Gauge.

Probe type		Gauge Type		
		F	N	FNF
FERROUS	F1 *	✓	✗	✓
	F2 *	✓	✗	✓
	F1 2 *	✓	✗	✓
	F3 *	✓	✗	✓
	F1 right angle	✓	✗	✓
	F2 right angle	✓	✗	✓
	F1 2 right angle	✓	✗	✓
	F1 telescopic	✓	✗	✓
	F2 telescopic	✓	✗	✓
	F1 PINIP™	✓	✗	✓
	F2 PINIP™	✓	✗	✓
	F1 2 PINIP™ High Temp	✓	✗	✓
	F3 PINIP™	✓	✗	✓
	FM3 miniature straight	✓	✗	✓
	FM3 miniature 45°	✓	✗	✓
	FM3 miniature 90°	✓	✗	✓

Probe type		Gauge Type		
		F	N	FNF
NON-FERROUS	N1 *	x	✓	✓
	N2	x	✓	✓
	N1 right angle	x	✓	✓
	N1A anodiser's	x	✓	✓
	N1 PINIP™	x	✓	✓
	NM3 miniature straight	x	✓	✓
	NM3 miniature 45°	x	✓	✓
	NM3 miniature 90°	x	✓	✓
DUAL	FNF1 *	x	x	✓
	FNF1 right angle	x	x	✓
	FNF PINIP™	x	x	✓

* indicates probes available for integral type gauges.

9.5 F1 2 PROBES

The F1 2 scale combines the F1 scale with the F2 scale in a single probe. The user selects the appropriate range for the work in hand. The resolution of the gauge is dependent on the scale selected on the gauge.

9.6 F1 2 HIGH TEMPERATURE PINIP™ PROBES



These probes are capable of measuring on surfaces up to 250°C (480°F). Wear appropriate protective clothing and take care to avoid bodily contact with the hot surface during measurement.

Do not exceed the maximum measurement speed when using these probes - see page 51.

Note: Refer to special calibration procedure - see "Calibrating High Temperature PINIP™ Probes" on page 31.

9.7 COATINGS ON GALVANISED OR METALLISED STEEL

The FNF probe in fixed N1 mode may be used to measure paint coatings on galvanised, aluminium (Al) or zinc (Zn) sprayed steel substrates.

1. Set the gauge to the N1 mode (**MENU/SETUP/PROBE**).
2. Zero and calibrate the gauge on a sample of the coated steel - see "Calibration adjustment" on page 23.

Care must be taken to ensure that the calibration conditions are not affected by changes in the zinc or aluminium coating thickness. This can be determined by checking the zero over an area of the galvanised or metal-coated steel. Metal coatings on steel above 50 µm (2 mil/thou) should be consistent enough to obtain a stable zero on the layer of metal.

3. Take readings.

10 PERSONALISED WELCOME SCREEN

A personalised welcome screen can be created and downloaded into the gauge.

Screen dimensions are 128 pixels x 64 pixels. The welcome screen is typically used to personalise the gauge with a logo, serial number, user name, etc. This is the first screen displayed when the gauge is switched on.

Use your Bluetooth® interface or PC connection cable with ElcoMaster software to create and upload the screen - see the instructions included with ElcoMaster.

11 STORAGE AND TRANSIT



This gauge incorporates a Liquid Crystal Display (LCD). If the display is heated above 50°C (120°F) it may be damaged.

This can happen if the gauge is left in a car parked in strong sunlight.

Always store the gauge in its carrying pouch when it is not being used.

Remove the batteries from the gauge and store them separately if the gauge is to remain unused for a long period of time. This will prevent damage to the gauge in the event of malfunction of the batteries.

12 MAINTENANCE

You own one of the finest hand-held coating thickness gauges in the world. If looked after, it will last a lifetime.

The gauge does not contain any user-serviceable components. In the unlikely event of a fault, the gauge should be returned to your local Elcometer supplier or directly to Elcometer. The warranty will

be invalidated if the gauge has been opened.
Contact details are stored in the gauge -
MENU/ABOUT/CONTACT.

Worldwide: sales@elcometer.com

Or USA/Canada: inc@elcometer.com

Note: Probes will eventually wear. Probe life will depend on the number of measurements taken and how abrasive the coating is. Probe life can be prolonged by careful positioning of the probe on the surface.

Replacement separate and PINIP™ probes can be fitted by the user without the need to return the gauge for service.

Gauges with an integral probe have to be returned for re-programming or replacement if the probe becomes worn or damaged.

13 STATISTICS TERMINOLOGY

Term		Meaning
COEF OF VARIAT'N	$CV\%$	Coefficient of Variation. The standard deviation divided by the mean for a group of readings, expressed as a percentage.
HIGHEST READING	\gg	The value of the maximum thickness in a group of readings.
LOWEST READING	\ll	The value of the minimum thickness in a group of readings.
MEAN	\bar{x}	The average of a group of readings; the sum of the individual readings divided by the number of readings.
NO. OF READINGS	n	Number of Readings. The running value for the number of readings taken in a group. In the case of the mode, the Number of Readings is the number of values recorded, not the total number of readings taken.
STD DEVIATION	σ	Standard Deviation. A statistical measure of the spread of values in a group of readings.
PERCENT GREATER OR EQUAL TO NDFT	$\geq n$	The percentage (%) of readings greater than or equal to the value of NDFT (see "Set NDFT" on page 33)
PERCENT BETWEEN 90% AND 100% NDFT	$\geq 90\%$	The percentage (%) of readings less than the value of NDFT but greater than 90% of the value of NDFT.
90:10 PASS / FAIL	$90:10$	90/10 test results: \checkmark = pass, \times ! = failed on 90% test, \times = fail due to a reading below 0.9xNDFT (if a number between 1 and 10 is displayed, insufficient measurements have been taken to be statistically valid - take more measurements)

14 TECHNICAL DATA

14.1 MEASUREMENT SPEED

>60 readings per minute.

When measuring high temperature materials measurement speed must be reduced to prevent overheating of the probe. The maximum measurement speed of the High Temperature PINIP™ probe at 250°C (480°F) is 4 readings per minute.

14.2 MINIMUM SUBSTRATE THICKNESS

Ferrous: 300 µm (12 mils)

Non-ferrous: 100 µm (4 mils)

Measurements can be taken on thinner substrates if 2-point calibration is carried out either side of the required substrate thickness, however gauges will have reduced range when adjusted for thin substrates.

14.3 PROBE OPERATING TEMPERATURE

Separate ferrous probes: 150°C (300°F)

High temperature PINIP™ probes: 250°C (480°F)

Miniature probes without outer sleeve: 150°C (300°F)

All other probes: 80°C (176°F)

14.4 PHYSICAL

Weight (including batteries):	Separate Probe (FNF1), 190g (6.7oz) Separate Probe (PINIP™), 155g (5.5oz) Integral Probe, 130g (4.6oz)
Dimensions:	130 mm x 70 mm x 35 mm (5.12" x 2.76" x 1.38")
Gauge operating temperature:	0°C to 50°C (32°F to 120°F) Operation outside these limits depends upon climatic conditions.
Case:	High impact ABS

14.5 POWER SUPPLY

Internal batteries, 2 x LR03 (AAA), alkaline^o dry batteries or rechargeable^p equivalents.

Battery life

30^q hours to 40 hours continuous use with alkaline dry batteries. (15 000 to 20 000 readings at an

average of 8 readings per minute.) Battery life is reduced by one third when using the backlight.

14.6 PACKAGING

The gauge is packed in cardboard and plastic packaging. Please ensure that this packaging is disposed of in an environmentally sensitive manner. Consult your Local Environmental Authority for further guidance.

-
- o. Alkaline batteries must be disposed of carefully to avoid environmental contamination. Please consult your local environmental authority for information on disposal in your region.

Do not dispose of any batteries in fire.

- p. Rechargeable batteries can be used if they are charged outside the gauge.
- q. Battery life is reduced to approximately 25% of dry battery life when using rechargeable batteries. Follow the instructions provided by the battery manufacturer when charging and disposing of rechargeable batteries.

15 ACCESSORIES

The Elcometer 456³ is complete with all the items required to get started and take measurements.

Many of the following accessories are optional. However, some are consumable items that may need to be replaced over the lifetime of the gauge.

All these accessories are available from Elcometer, or your local Elcometer supplier. At time of ordering please quote the sales part number which follows the description of each accessory.

15.1 PROBES

Full details of the extensive range of 456 probes can be obtained from Elcometer, your local Elcometer supplier or the Elcometer website, www.elcometer.com.

15.2 FOIL SETS

2.2 mm (85 mils) 8 pieces:	T9904199F
1.3 mm (51 mils) 3 pieces:	T9904199G
5.5 mm (220 mils) 4 pieces:	T9904199J
15 mm (595 mils) 4 pieces:	T9904199K

Individual foils in the range 12.5 μ m to 20 mm (0.5 mil to 790 mils) and customised sets chosen from this range are also available. Consult your local Elcometer supplier.

15.3 CALIBRATION CERTIFICATES FOR FOILS

Certificates traceable to National Standards including UKAS and NIST are available on request.

15.4 TEST CERTIFICATES

A certificate with results of a standard test on known foil values over the full range of the probe. Order using sales part number TEST-456.

15.5 COATED THICKNESS STANDARDS INCLUDING CERTIFICATE

Ferrous Standard (4 Values):	T995111261
Non-Ferrous Standard (4 Values):	T995111271
Ferrous Standard (2 Values):	T995166001
Non-Ferrous Standard (2 Values):	T995166011

15.6 PROBE PLACEMENT JIG

To aid probe positioning on small components a probe placement jig is available and an adapter suitable for use with the full range of miniature probes is also available as an accessory.

Probe placement jig:	T95012880
----------------------	-----------

15.7 PROBE ADAPTERS

Jumbo Hand Grip (F and N probes):	T9997766-
Jumbo Hand Grip (FNF probes):	T99913225
V Adapter for pipes (F & N probes):	T9997381-

V Adapter for pipes (FNF probes):	T99913133
-----------------------------------	-----------

15.8 Miniprinter

42 column, rechargeable battery powered Miniprinter complete with charger. Three charger options:

230V (UK Plug):	X4569964B
230V (European Plug):	X4569964C
110V (US Plug):	X4569964D

Miniprinter spares

456 to printer connection cable (25-pin):	T45616267
Ribbon Cassettes (Pack of 5):	T9769992-
Paper Rolls (Box of 20):	T9999993-

15.9 BENCH STANDS

Integral Probe Version:	T45616161
Integral/Separate Probe Version:	T45616162

15.10 PC CONNECTION CABLE

456 to PC Connection Cable (9-pin):	T99916217
-------------------------------------	-----------

Note: A 9-pin to 25-pin adapter may be required for certain PC RS232 ports.

15.11 BLUETOOTH® MODULE

USB Bluetooth® Module:	T99920130
------------------------	-----------

16 RELATED EQUIPMENT


Elcometer produces a wide range of coating thickness gauges and associated paint inspection equipment. Users of the Elcometer 456³ may also benefit from the following Elcometer products:

- Uncured powder thickness gauges
- Coatings analyser
- Inspection management software
- Mechanical coatings thickness gauges
- Appearance testers
- Adhesion testers


For further information contact Elcometer, your local Elcometer supplier or visit www.elcometer.com

17 FITTING THE WRIST HARNESS


1. Pass harness round pin

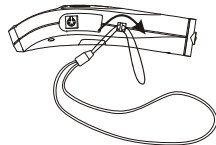

2. Pass harness through loop



3. Pull tight

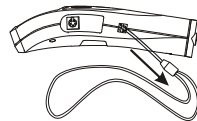

18 PROBE MEASUREMENT PERFORMANCE

Scale	Total range	Accuracy ^a	Resolution	in range
F1	0 µm to 1500 µm	±1% to ±3% or ±2.5 µm	0.1 µm	0 µm to 99.9 µm
F1 2 (F1 mode)			1.0 µm	100 µm to 1500 µm
FNF1	0 mil to 60 mils	±1% to ±3% or ±0.1 mil	0.01 mil	0 mil to 4.99 mils
N1, N1A			0.1 mil	5 mils to 60 mils
F1 2 (F2 mode)	0 mm to 5.0 mm	±1% to ±3% or ±0.02 mm	1.0 µm	0 mm to 0.99 mm
N2			10 µm	1.0 mm to 5.0 mm
	0 mil to 200 mils	±1% to ±3% or ±1 mil	0.1 mil	0 mil to 49.9 mils
			1 mil	50 mils to 200 mils
F3	0 mm to 13 mm	±1% to ±3% or ±0.05 mm	1.0 µm	0 mm to 1.99 mm
			10 µm	2 mm to 13 mm
	0 mil to 500 mils	±1% to ±3% or ±2.0 mils	0.1 mil	0 mil to 99.9 mils
			1 mil	100 mils to 500 mils
FM3	0 µm to 500 µm	±1% to ±3% or ±2.5 µm	0.1 µm	0 µm to 99.9 µm
NM3			1.0 µm	100 µm to 500 µm
	0 mil to 10 mils	±1% to ±3% or ±1.0 mil	0.01 mil	0 mil to 3.99 mils
			0.1 mil	4 mils to 10 mils
F6	0 mm to 25 mm	±1% to ±3% or ±0.1 mm	10 µm	0 mm to 1.99 mm
			100 µm	2 mm to 25 mm
	0 mil to 980 mils	±1% to ±3% or ±2.0 mils	1 mil	0 mil to 99.9 mils
			10 mil	100 mils to 980 mils
N6	0 mm to 30 mm	±1% to ±3% or ±0.05 mm	10 µm	0 mm to 1.99 mm
			100 µm	2 mm to 30 mm
	0 mil to 1200 mils	±1% to ±3% or ±2.0 mils	1 mil	0 mil to 99.9 mils
			10 mil	100 mils to 1200 mils

a. Whichever is the greater. Lower value achieved when calibrated close to the thickness to be measured.

19 PROBE CAPABILITIES

19.1 INTEGRAL PROBES

Probe type	Minimum convex surface diameter	Minimum concave surface radius	Headroom	Minimum sample diameter	Cal foil value ^a
F1 (or F1 2 set for F1 operation)	4 mm (0.16")	25 mm (0.98")	130 mm (5.1")	4 mm (0.16")	250 µm (10 mil)
F1 2 (set for F2 operation)	4 mm (0.16")	25 mm (0.98")	135 mm (5.3")	8 mm (0.32")	1 mm (40 mil)
F3	15 mm (0.59")	40 mm (1.57")	150 mm (5.9")	14 mm (0.55")	2.5 mm (100mil)
N1 (N)	35 mm (1.38")	25 mm (0.98")	130 mm (5.1")	6 mm (0.24")	250 µm (10 mil)
FNF1 (N)	38 mm (1.50")	25 mm (0.98")	135 mm (5.3")	8 mm (0.32")	250 µm (10 mil)
FNF1 (F)	4 mm (0.16")	25 mm (0.98")	135 mm (5.3")	4 mm (0.16")	250 µm (10 mil)

- a. This is the recommended maximum calibration foil value to achieve the specified accuracy under these measurement conditions

19.2 SEPARATE FERROUS PROBES

Probe type	Minimum convex surface diameter	Minimum concave surface radius	Headroom	Minimum sample diameter	Cal foil value ^a
F1 (or F1 2 set to F1)	4 mm (0.16")	25 mm (0.98")	85 mm (3.35")	4 mm (0.16")	250 µm (10 mil)
F1 2 (set to F2)	4 mm (0.16")	25 mm (0.98")	89 mm (3.50")	8 mm (0.32")	1 mm (40 mil)
F1 Right Angle (or F1 2 set to F1)	4 mm (0.16")	25 mm (0.98")	28 mm (1.10")	4 mm (0.16")	250 µm (10 mil)
F1 2 Right Angle (set to F2)	4 mm (0.16")	25 mm (0.98")	32 mm (1.26")	8 mm (0.32")	1 mm (40 mil)
F1 Telescopic	4 mm (0.16")	25 mm (0.98")	32 mm (1.26")	4 mm (0.16")	250 µm (10 mil)
F1 2 Telescopic	4 mm (0.16")	25 mm (0.98")	36 mm (1.42")	8 mm (0.32")	1 mm (40 mil)
F3	15 mm (0.59")	40 mm (1.57")	102 mm (4.02")	14 mm (0.55")	2.5 mm (100 mil)
F6	35 mm	170 mm	150 mm	51 x 51 mm (2" x 2")	5 mm (200 mil)

- a. This is the recommended maximum calibration foil value to achieve the specified accuracy under these measurement conditions

19.3 SEPARATE NON-FERROUS PROBES

Probe type	Minimum convex surface diameter	Minimum concave surface radius	Headroom	Minimum sample diameter	Cal foil value ^a
N1	35 mm (1.38")	25 mm (0.98")	85 mm (3.35")	6 mm (0.24")	250 µm (10 mil)
N1 Right Angle	35 mm (1.38")	25 mm (0.98")	28 mm (1.10")	6 mm (0.24")	250 µm (10 mil)
N1A Anodiser's Probe	35 mm (1.38")	25 mm (0.98")	85 mm (3.35")	6 mm (0.24")	250 µm (10 mil)
N2	100 mm (3.97")	150 mm (5.90")	85 mm (3.35")	14 mm (0.55")	1 mm (40 mil)
N6	Flat surface	400 mm	160 mm	58 mm	Any

- a. This is the recommended maximum calibration foil value to achieve the specified accuracy under these measurement conditions

19.4 SEPARATE DUAL FNF

Probe type	Minimum convex surface diameter	Minimum concave surface radius	Headroom	Minimum sample diameter	Cal foil value^a
FNF1 (N)	38 mm (1.50")	25 mm (0.98")	88 mm (3.46")	8 mm (0.32")	250 µm (10 mil)
FNF1 (F)	4 mm (0.16")	25 mm (0.98")	88 mm (3.46")	4 mm (0.16")	250 µm (10 mil)
FNF1 Right Angle (N)	38 mm (1.50")	25 mm (0.98")	34 mm (1.34")	8 mm (0.32")	250 µm (10 mil)
FNF1 Right Angle (F)	4 mm (0.16")	25 mm (0.98")	34 mm (1.34")	4 mm (0.16")	250 µm (10 mil)

- a. This is the recommended maximum calibration foil value to achieve the specified accuracy under these measurement conditions

19.5 PINIP™ PROBES

Probe type	Minimum convex surface diameter	Minimum concave surface radius	Headroom	Minimum sample diameter	Cal foil value ^a
F1 (or F1 2 set to F1)	4 mm (0.16")	60 mm (2.36")	155 mm (6.10")	4 mm (0.16")	250 µm (10 mil)
F1 2 (set to F2)	4 mm (0.16")	60 mm (2.36")	159 mm (6.25")	8 mm (0.32")	1 mm (40 mil)
F3	15 mm (0.59")	45 mm (1.77")	169 mm (6.65")	14 mm (0.55")	2.5 mm (100mil)
N1	35 mm (1.38")	50 mm (1.97")	155 mm (6.09")	6 mm (0.24")	250 µm (10 mil)
FNF1 (N)	38 mm (1.50")	55 mm (2.17")	156 mm (6.15")	8 mm (0.32")	250 µm (10 mil)
FNF1 (F)	4 mm (0.16")	55 mm (2.17")	156 mm (6.14")	4 mm (0.16")	250 µm (10 mil)

- a. This is the recommended maximum calibration foil value to achieve the specified accuracy under these measurement conditions

19.6 SEPARATE MINIATURE FERROUS PROBES

Probe Type	Minimum convex surface diameter	Minimum concave surface radius	Minimum sample diameter	Minimum access height	Minimum access width	Overall length (headroom)
F, Straight, 45 mm (1.77")	1.5 mm (0.06")	6.5 mm (0.26")	3 mm (0.12")	6 mm (0.24")		150 mm (5.91")
F, Straight, 150 mm (5.9")	1.5 mm (0.06")	6.5 mm (0.26")	3 mm (0.12")	6 mm (0.24")		260 mm (10.24")
F, 45°, 45 mm (1.77")	1.5 mm (0.06")	6.5 mm (0.26")	3 mm (0.12")	18 mm (0.71")	7 mm (0.28")	145 mm (5.71")
F, 45°, 150 mm (5.9")	1.5 mm (0.06")	6.5 mm (0.26")	3 mm (0.12")	18 mm (0.71")	7 mm (0.28")	250 mm (9.84")
F, 90°, 45 mm (1.77")	1.5 mm (0.06")	6.5 mm (0.26")	3 mm (0.12")	16 mm (0.63")	7 mm (0.28")	140 mm (5.51")
F, 90°, 150 mm (5.9")	1.5 mm (0.06")	6.5 mm (0.26")	3 mm (0.12")	16 mm (0.63")	7 mm (0.28")	245 mm (9.64")

19.7 SEPARATE MINIATURE NON-FERROUS PROBES

Probe Type	Minimum convex diameter	Minimum concave radius	Minimum sample diameter	Minimum access height	Minimum access width	Overall length (headroom)
NF, Straight, 45 mm (1.77")	3 mm (0.12")	25 mm (0.98")	4 mm (0.16")	6 mm (0.24")		150 mm (5.91")
NF, Straight, 150 mm (5.9")	3 mm (0.12")	25 mm (0.98")	4 mm (0.16")	6mm (0.24")		260 mm (10.24")
NF, 45°, 45 mm (1.77")	3 mm (0.12")	25 mm (0.98")	4 mm (0.16")	18 mm (0.71")	7 mm (0.28")	145 mm (5.71")
NF, 45°, 150 mm (5.9")	3 mm (0.12")	25 mm (0.98")	4 mm (0.16")	18 mm (0.71")	7 mm (0.28")	250 mm (9.84")
NF, 90°, 45 mm (1.77")	3 mm (0.12")	25 mm (0.98")	4 mm (0.16")	16 mm (0.63")	7 mm (0.28")	140 mm (5.51")
NF, 90°, 150 mm (5.9")	3 mm (0.12")	25 mm (0.98")	4 mm (0.16")	16 mm (0.63")	7 mm (0.28")	245 mm (9.64")

20 ERROR MESSAGES

Under certain conditions the gauge will display error messages (Figure 60). These messages are normally cleared by pressing any one of the softkeys. The cause of the error will be indicated by the message and should be corrected before proceeding.

Error message	Causes	Action to take
#1 - PROBE	Probe-to-gauge communication failure.	Integral gauge - return to Elcometer*. Separate gauge - remove probe and refit. If error persists, return to Elcometer*.
#2 - PROBE	Corrupt data output from probe.	Integral gauge - return to Elcometer*. Separate gauge - try new probe. If error persists, return to Elcometer*.
#3 - PROBE	Internal error.	Return to Elcometer*.
PROBE UNSUPPORTED	a) Probe is dual FNF, but gauge is ferrous only, or non-ferrous only. See page 45. b) Old gauge software does not support new probe.	a) Gauge model F and gauge model N cannot be used with a dual FNF probe. b) Return to Elcometer* for software upgrade.
PROBE CHANGED	Probe has been changed.	Calibration adjustment required.
UNSTABLE READING	a) External electro-magnetic interference. b) Gauge faulty.	a) Isolate from electro-magnetic interference. b) Return to Elcometer*.

Error message	Causes	Action to take
VALUE TOO LARGE	Numerical error.	Switch gauge off then on again. If error persists contact Elcometer.
CALIBRATION	Incorrect calibration calculation.	Re-calibrate. If error persists, return to Elcometer*.
LANGUAGE MEMORY	Software error.	Return to Elcometer*.

* Contact Elcometer or your local Elcometer Supplier to arrange return.



Figure 60. Example error message - no probe is connected to gauge

21 INDEX

Numerics

2 Point calibration method	24
90/10 rule	33

A

Accessories	52
AS 2331.1.4	5
AS 3894	25
AS 3894.3-B	5
AS/NZS 1580.108.1	5
ASTM B 499	5
ASTM D 1186-B	5
ASTM D 1400	5
ASTM D 7091	5
ASTM E 376	5
ASTM G 12	5
Australian calibration method	25

B

Batch mode	35
Batch numbering	40
Batches	
Copying (Cloning)	36
Reviewing	41
Batching	35
Creating new batch	36
Data collection method	38
Exiting	36
Opening existing batch	40
Batteries	
Fitting	7
Life of	51

Precautions	48
Rechargeable	
Charging	52
Life of	7
Specification	51
Baud rate	22
Beep	
Changing volume	23
Switching off	23
Bluetooth	43
Icon in display	14
Transferring readings	43
Bluetooth module	54
BS 3900 (C5)	5
BS 3900(C5)	5
BS 5411 (11)	5
BS 5411 (3)	5
BS 5599	5

C

Cable	
PC to gauge	54
CAL softkey	
Flashing	25
Calibration	
Adjustment	25
Coated standards	26
Coated thickness standards	26
FNF probes	23
Folds	26
Locking	15
Methods	24

Shims	26
Calibration Adjustment	26
Procedure, 2Point	30
Procedure, Rough	30
Procedure, Smooth	27
Procedure, Special substrate	30
Calibration certificates	53
Calibration methods	
2 POINT	24
AUSTRALIAN	25
ISO	25
ROUGH	24
SET OFFSET	24
SPECIAL SUB	24
SSPC	25
SWEDISH	25
ZERO OFFSET	24
Character size	10
Clock and alarm	21
Cloning a batch	36
Coated thickness standards	26
Spares	53
Coatings	
On galvanised steel	47
On metallised steel	47
Coefficient of Variation	50
Computer	
Connection cable	54
Computer, transferring data to	43
Copying a batch	36

D

Data collection method	38
Counted average	38
Normal	38
Data, activating	21
Date stamp	21
Delete all batches	20
Delete last reading	19
Delete single batch	20
Deleting readings	
Permanent or tagged	21
Dimensions	51
DIN 50981	5
DIN 50984	5
Display	
Changing size of fonts	23
Character size	10
Locking softkeys	23

E

ECCA T1	5
EDTS+ Excel Link	43
ElcoMaster	43
Elcometer 456	
Features	5
Overview	4
EN 13523-1	5
Error messages	64
ESC	27
Extended menu	
Contents	19

F

Factory calibration	16
FNF	46

Foils	26
Ordering	53

G

Galvanised steel	47
Gauge information	16

H

High temperature	47
Highest reading	50

I

Immediate mode	35
IMO MSC.215 (82/84)	5
IMO, testing to standards of	33
Interface	12
RS232	12
International gauge settings	16
ISO 1461	5
ISO 19840	5, 24, 25
ISO 2063	5
ISO 2360	5
ISO 2808-12	5
ISO 2808-7C	5
ISO 2808-7D	5
ISO calibration method	25

K

Keypad	9
--------	---

L

Language, selecting	11
Limits	

Setting	41
Lowest reading	50

M

Maintenance	48
Mean	50
Measurement speed	51
Memory	
Amount available	42
Menu items	
2-POINT	24
ABOUT	16
AUSTRALIAN	25
AUTO SWITCH OFF	22
BACKLIGHT	15
BAUD RATE	22
BEEP VOLUME	23
BLUETOOTH PC REPLY	22
CAL METHOD	20
CALIBRATION LOCKED	15
CLEAR STATS	32
CLOCK/ALARM	21
CONTACT	16
DATA	21
DATA MENU	36
DELETE	19
DELETED READING	21
DISPLAY	35
ENLARGE STATS	32
EXIT BATCHING	36
EXTENDED MENU	18
FACTORY CAL	16
FREE MEMORY	42
GAUGE INFORMATION	16

HELP	16	ZERO OFFSET	24	All batches of readings	19
INTL GAUGE	16	Menus		Batch of readings	19
ISO	25	Extended off (simple)	15	Statistical summary	19
LANGUAGES	23	Extended on	18	Printing readings	22
LARGE FONTS	23	Overview	15	To Bluetooth	22
OPEN EXISTING BATCH	40	Structure	18	Probe positioning jig	53
OPEN NEW BATCH	36	Metallised steel	47	Probes	45
OPENING SCREEN	23	Minimum substrate thickness	51	Adapters	53
OUTPUT	22	Mode		Capabilities	57–63
PRINT/OUTPUT	19	Batch	35	Extending life of	49
PROBE	21	Immediate	35	F (Ferrous)	
PROBE INFORMATION	16			What used for	45
RESET	16	N		F1 2	
REVIEW BATCHES	41	NDFT, adjusting	33	High Temperature PINIP	47
ROUGH	24	NF T30-124	5	Substrate selection modes	21
RS232 BIT IMAGE	22	NSTM 631	5	F1 2 overview	47
RS232 PLAIN TEXT	22	Number of readings	50	Fitting of	8
SELECT STATS	32			FNF (Ferrous/Non-ferrous)	
SET LIMITS	41	O		Substrate selection modes	21,
SET NDFT	33	On/off	9	46	
SET OFFSET	24	Opening screen		What used for	46
SETUP	20	Creating	48	Maximum temperature	51
SHOW DATE STAMP	21	Disabling	23	N (Non-ferrous)	
SMOOTH	24			What used for	46
SOFTKEY ENABLED	21	P		Performance	56
SOFTKEYS LOCKED	23	Packaging	52	PINIP	
SPECIAL SUB	24	PIN	44	What used for	45
SSPC	25	PINIP probes		Replacement of	49
STATISTICS	20	Fitting of	8	Wear of	49
STATS MENU	31	High temperature	47	Which one to use?	46
STATS ON LCD	32	Power supply	51	PSPC readings	
SWEDISH	25	Printer		90/10 rule	33
TAG	21	Miniprinter	54	About	33
UNITS	21	Printing		Transferring to ElcoMaster	45
USA GAUGE	17				

Q

Quick-start	6
-------------	---

R

Reading screen	10
Typical	13
Reading, taking	12
Resetting the gauge	16
Rough calibration method	24
RS232 interface	12

S

Scale selection, F1 F2	21
Screen	
Welcome information	10
Screen symbols	
Battery condition	7
Definition of	16
Screen symbols, explanation of	16
Set offset	24
Setting up the gauge	20
Shims	26
Ordering	53
Simple menu	
Turning on/off	16
Smooth calibration method	24
SMS 6310-081-015	5
Softkey	
BACK	15
CAL	13, 30
Flashing	14
Procedure	26
DATA	36
DATA COLLECTION METHOD	38

ESC	27
MENU	13
SEL	14
SET	28, 29
TEST	27
UP/DOWN	14
ZERO	29
Software	43
Data conversion	43
ElcoMaster	43
Special sub calibration method	24
SS 18 41 60	25
SSPC calibration method	25
SSPC-PA 2	25
SSPC-PA2 (2004)	5
Standard deviation	50
Standards	5
AS 3894	25
Coated thickness	53
ISO 19840	25
SS 18 41 60	25
SSPC-PA 2	25
Statistics	
Activating	20
Choice of	32
Clearing	32
Displaying on screen	32
Dual function probes	35
Increasing size on display	32
Overview	31
Terminology	50
Substrate selection	
Automatic	21, 46
Manual	21, 46
Substrate thickness	

Minimum	51
Swedish calibration method	25
Switching on/off	9
Automatically	10, 22

T

Temperature	
Effect on measurement speed	51
High, measuring of	47
Operating	51
Probes, maximum	51
Test certificates	53
Test readings	29
Testing calibration of gauge	30
Tick box	14
Transferring data to computer	43
Bluetooth	43

U

Units	
Automatic setting of	21
Manual setting of	21
Up/Down	14
US gauge settings	17
US NAVY NSI 009-32	5
US NAVY PPI 63101-000	5

W

Weight	51
Welcome screen	
Creating	48
Disabling	23
Wrist harness, fitting of	55

